




Specify Part No. by required I.D. and thickness.
(e.g.) I.D. is 18.2mm and thickness is 3mm.

30W - 1803 Parts No.



- Use Oiles 300 in lubrication oil or with periodic lubrication.
- Part no. with N at the end is no-hole type.

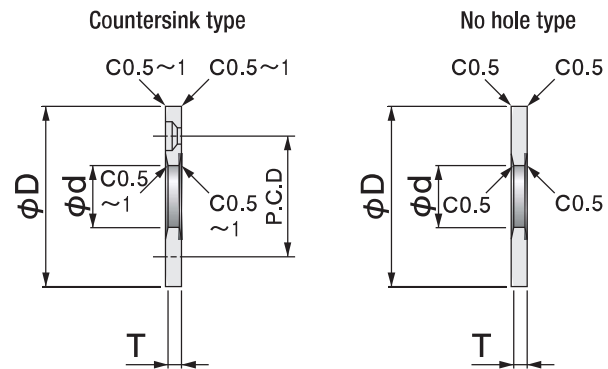

| Parts No. | I.D. | | O.D. | Thickness | | Mounting hole | | |
|------------------|------|------------------------------------------------------|------|-----------|---------------------------------------------------|----------------|--------------|------------------------|
| | φd | Tolerance | φD | T | Tolerance | P.C.D | No. of holes | Countersink screw size |
| 30W-1003N | 10.2 | $\begin{smallmatrix} +0.2 \\ +0.1 \end{smallmatrix}$ | 30 | 3 | $\begin{smallmatrix} 0 \\ -0.1 \end{smallmatrix}$ | no attach hole | | |
| 30W-1203N | 12.2 | $\begin{smallmatrix} +0.2 \\ +0.1 \end{smallmatrix}$ | 40 | 3 | $\begin{smallmatrix} 0 \\ -0.1 \end{smallmatrix}$ | no attach hole | | |
| 30W-1303N | 13.2 | $\begin{smallmatrix} +0.2 \\ +0.1 \end{smallmatrix}$ | 40 | 3 | $\begin{smallmatrix} 0 \\ -0.1 \end{smallmatrix}$ | no attach hole | | |
| 30W-1403N | 14.2 | $\begin{smallmatrix} +0.2 \\ +0.1 \end{smallmatrix}$ | 40 | 3 | $\begin{smallmatrix} 0 \\ -0.1 \end{smallmatrix}$ | no attach hole | | |
| 30W-1603N | 16.2 | $\begin{smallmatrix} +0.2 \\ +0.1 \end{smallmatrix}$ | 50 | 3 | $\begin{smallmatrix} 0 \\ -0.1 \end{smallmatrix}$ | no attach hole | | |
| 30W-1803 | 18.2 | $\begin{smallmatrix} +0.2 \\ +0.1 \end{smallmatrix}$ | 50 | 3 | $\begin{smallmatrix} 0 \\ -0.1 \end{smallmatrix}$ | 35 | 2 | M3 |
| 30W-2005 | 20.2 | $\begin{smallmatrix} +0.2 \\ +0.1 \end{smallmatrix}$ | 50 | 5 | $\begin{smallmatrix} 0 \\ -0.1 \end{smallmatrix}$ | 35 | 2 | M5 |
| 30W-2505 | 25.2 | $\begin{smallmatrix} +0.2 \\ +0.1 \end{smallmatrix}$ | 55 | 5 | $\begin{smallmatrix} 0 \\ -0.1 \end{smallmatrix}$ | 40 | 2 | M5 |
| 30W-3005 | 30.2 | $\begin{smallmatrix} +0.2 \\ +0.1 \end{smallmatrix}$ | 60 | 5 | $\begin{smallmatrix} 0 \\ -0.1 \end{smallmatrix}$ | 45 | 2 | M5 |
| 30W-3505 | 35.2 | $\begin{smallmatrix} +0.2 \\ +0.1 \end{smallmatrix}$ | 70 | 5 | $\begin{smallmatrix} 0 \\ -0.1 \end{smallmatrix}$ | 50 | 2 | M5 |
| 30W-4007 | 40.2 | $\begin{smallmatrix} +0.2 \\ +0.1 \end{smallmatrix}$ | 80 | 7 | $\begin{smallmatrix} 0 \\ -0.1 \end{smallmatrix}$ | 60 | 2 | M6 |
| 30W-4507 | 45.2 | $\begin{smallmatrix} +0.2 \\ +0.1 \end{smallmatrix}$ | 90 | 7 | $\begin{smallmatrix} 0 \\ -0.1 \end{smallmatrix}$ | 70 | 2 | M6 |
| 30W-5008 | 50.3 | $\begin{smallmatrix} +0.3 \\ +0.1 \end{smallmatrix}$ | 100 | 8 | $\begin{smallmatrix} 0 \\ -0.1 \end{smallmatrix}$ | 75 | 4 | M6 |